

# BIOS Revision History

Bios name	Remarks
FS51S025	Date code: 07/17/2002 checksum: E600 Initial release.
FS51S031	Date code: 08/21/2002 checksum: 9100 1.Add one more selection,fan1 & fan3, under the item (user set CPU fan). 2.Fixed cv20 TV-out shows as Black and white. 3.Fixed using LCD device, system can't load up to OS. 4.Remove the item "Under Scan/Over Scan Select". 5.Fixed the error transfer message to TV. 6.Fixed installing AC97 drivers pop out error message.
FS51S035	Date code: 09/11/2002 checksum: 9200 1.Added CPU auto parking function. 2.Fixed the system crash issue in CMOS setup utility when plugging USB Flash Disk & USB Keyboard at the same time. 3.Changed "third boot device" default value as "CD-ROM". 4.Changed "SIS AC97 AUDIO" default value as "enable" 5.Added DRAM clock string on First BIOS POST.
FS51S038	Date:10/01/2002 checksum: 9500 1.Sis chipset(651 A&648A)can't support hyper-threading cpu resume from s3, so when we plug hyper-threading cpu then s3 item selection will be disappear. 2.Fixed Intel celeron2.0GHz sign-on message show 2.0A GHz (100X2.0) 3.Fixed use Dmicfg.exe to detect Intel celeron2.0GHz L2 catch show not correct (Update Cache Description Table to follow Intel NetBurst Micro-Architecture BIOS Writer's Guide) 4.Changed value of SafeRatio for Intel sample P4 CPU with Hyper-Threading(ratio can't set to 21) 5.fixed fan control at low speed is not stable. checksum: 9500

Close this window