

## HP Consumer Support

# Motherboard Specifications, FW37T (Oslo)

[Print](#) [Share](#)

[Motherboard Layout and Photographs](#)

<b>Motherboard Supplier</b>	FIC
<b>Motherboard Name</b>	Manufacture Name: FIC37T HP Name: Oslo
<b>System BIOS Supplier</b>	FIC/Award
<b>Form Factor</b>	uATX
<b>Processor Brand</b>	Intel
<b>Processor Socket Type</b>	Socket-370
<b>Processor Family</b>	Celeron (Tualatin, CuMine)
<b>Maximum Processor Core Frequency</b>	1.5GHz Tualatin
<b>Proc. Front Side Bus Freq.</b>	100MHz
<b>Chipset Name</b>	Intel i810E
<b>Chipset "North Bridge" and Revision</b>	GMCH
<b>Chipset "South Bridge" and Revision</b>	ICH2
<b>Super I/O</b>	ITE IT8712F-A
<b>Flash BIOS Device</b>	FWH 4Mbit
<b>Memory Type</b>	SDRAM
<b>Memory Speed</b>	PC133 (runs at 100MHz)
<b>Memory Sockets</b>	2 DIMM
<b>Maximum Memory</b>	512MB
<b>256Mbit Memory Support</b>	No
<b>Graphics Supplier</b>	Intel
<b>Graphics Configuration</b>	Down, In Chipset
<b>Onboard Graphics Memory</b>	UMA (Intel DVT)
<b>Graphics Connector (AGP)</b>	None
<b>TV-Out Device</b>	Chrontel CH7009
<b>TV-Out Configuration</b>	Daughtercard
<b>Audio Configuration</b>	AC'97 Down
<b>AC'97 CODEC Device</b>	Realtek ALC201
<b>Audio Jacks (Legend Below)</b>	M,LI,LO,MIDI/Game
<b>M</b>	Microphone
<b>LI</b>	Line In

Contact HP

Product (e.g. Deskjet D2680)

Question or keywords



## Tips

**We are currently updating our customer support system and are unable to process your service order at this time. Please check back after September 14th (10:00 AM MT) for your order status.**

[Extend your warranty with HP Care Pack Services](#)

[Check out the HP Total Care Support Videos](#)

## Related support links

[Check warranty status](#)

[Check repair order](#)

## HP Support forums

Find solutions and collaborate with others on the HP Support Forum

[Join the conversation](#)


## Follow us



<b>LO</b>	Line out	
<b>SO</b>	Speaker	
<b>M/G</b>	Midi/Game	
<b>CD-In Jack</b>		1
<b>Internal Spkr-Out/Line-Out/Headphone-Out Header</b>		Speaker out header
<b>Ethernet 10/100 LAN Supplier</b>		Realtek RTL8100L
<b>Ethernet Configuration</b>		Down
<b>IDE UDMA Modes</b>		ATA-100/66/33
<b>Expansion Slots (AGP/PCI/Exten)</b>		3 PCI
<b>USB Specific</b>		USB 1.1
<b>USB Ports (Front)</b>		2
<b>USB Ports (Rear)</b>		2
<b>Serial, Parallel, Floppy, PS2 Kbd and Mouse</b>		1S, 1P, 1F, PS2 K+M
<b>Serial Port Front Chassis Option</b>		No
<b>Fan Headers (CPU, System, Power Supply)</b>		CPU, System
<b>Available Mfg Options</b>		-GLAS, TV-Out card
<b>A</b>	Audio down on motherboard	
<b>C</b>	External L2 cache on motherboard	
<b>E</b>	1394 on motherboard	
<b>G</b>	Graphics down (on motherboard or in chipset)	
<b>L</b>	LAN on motherboard (ethernet)P - PCMCIA slot	
<b>S</b>	S3 power management support	
<b>T</b>	TV-out on motherboard	
<b>U</b>	Graphics card (up, not on motherboard)	
<b>W</b>	MS (R) Windows XP hardware compliant	

---


## Motherboard Layout and Photographs

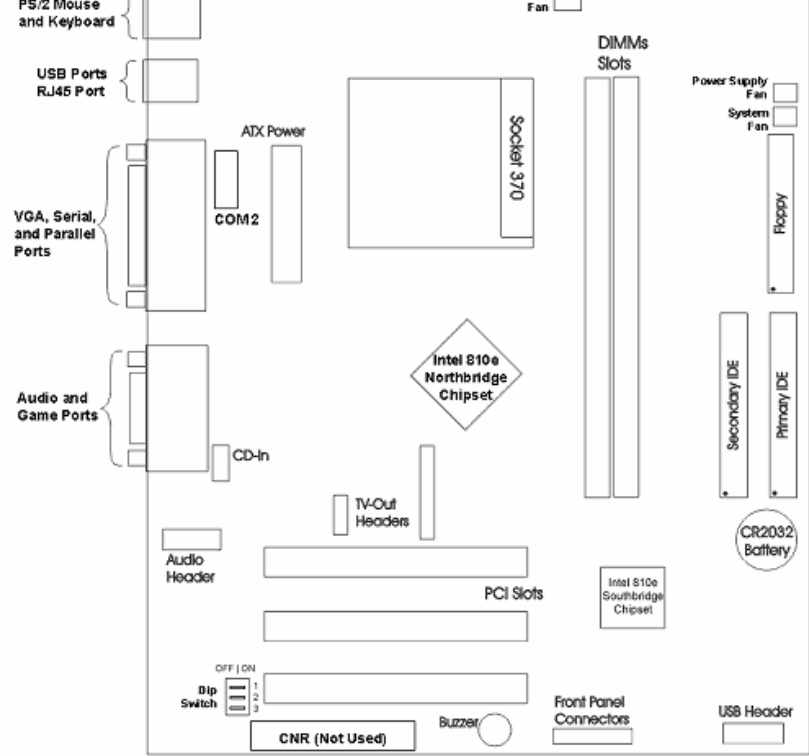

**Figure 1: Photograph**



**Figure 2: Backplate**

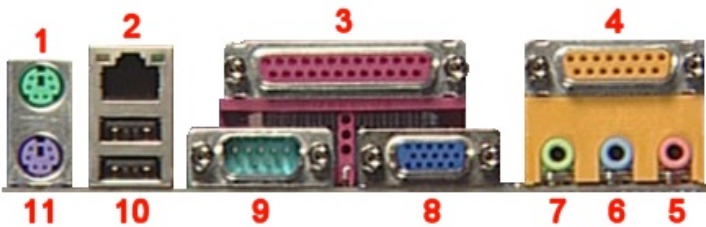

**1 - Mouse**

**2 - RJ45**

**3 - Parallel**

**4 - Gameport**

**5 - Microphone**

**6 - Line-out**

**7 - Line-in**

**8 - VGA**

**9 - Serial**

**10 - USB**

**11 - Keyboard**

[Back to top](#)

 [United States](#)  
[Mobile version](#)

**About HP**

[Contact us](#)  
[Newsroom](#)  
[Investor relations](#)  
[Living Progress](#)  
[Accessibility](#)  
[Events](#)  
[HP Labs](#)  
[Jobs](#)

**Social Media**

[Consumer support forum](#)  
[Enterprise business community](#)  
[Corporate blogs](#)



**HP Partners**

[Become a partner](#)  
[Find a reseller](#)  
[PartnerOne](#)

**Customer Support**

[Power cord replacement](#)  
[Download drivers](#)  
[Register your product](#)  
[Authorized service providers](#)  
[Training & certification](#)  
[Product recycling](#)

---

[Home](#) | [Email sign-up](#) | [Site map](#) | [Privacy](#) | [Cookies & ad choices](#) | [Terms of use](#) | [Recalls](#)

© 2014 Hewlett-Packard Development Company, L.P.

[View mobile site](#)